



BRAKES

ENGINEERED SOLUTIONS

Bulletin BES 08-23

Subject: ECE 13 Response

Vehicle Involved: Late model Chevy Colorado, GMC Canyon

Condition: ABS Light on after repairing fault and clearing code

Repair Procedure: The setting of certain DTCs may cause the ABS light to remain on during the subsequent ignition cycle until the vehicle is operated at a speed greater than 7 MPH (10Km/h) and no fault is detected. This is referred to as an ECE 13 response. Before attempting to diagnose other possible causes, drive the vehicle above 7 MPH to be sure that the reason the light is still on after repairing the vehicle and clearing the code, is not due to the ECE 13 response.