



**BRAKES**

# ENGINEERED SOLUTIONS

**Bulletin BES 03-15**

**Subject:** Traction Engaged / Anti Lock Brake Light: DTC C1225

<b>Vehicle Involved</b>	1997	Cadillac Seville
	1997-1999	Cadillac DeVille
	1997-2000	Cadillac Eldorado

**Condition:** When accelerating from a stop, some customers may complain of several conditions that relate to Traction Control / Anti Lock Brake System problems. These include an under hood noise that may be heard from the passenger side compartment. The antilock pump motor running most likely is the noise. Traction engaged lamp might also momentarily be illuminated on the driver message center. Diagnostic trouble code C1225 may illuminate the ABS warning lamp. The code may be set as a current or history code.

According to Cadillac, the above conditions may be the result of electrical noise that is induced into the left front wheel speed sensor circuit. Electrical activity from surrounding wires may be the cause.

**REPAIR:** If these conditions cannot be repaired through traditional diagnostic procedures, a new left front wheel speed sensor harness with improved insulating qualities is available through Cadillac. The new part number is 12167672.