



BRAKES

ENGINEERED SOLUTIONS

Bulletin BES 02-13

Subject: Front ABS Harness Rubs Against Wheel

Vehicle Involved: 1998 Honda Accord V6 thru Vin 1HGCG1...WA005034

Condition: Front wheel speed sensor harness contacting front wheels or tires.

Repair Procedure: Inspect the wheel speed sensor harness with the vehicle on the ground. Turn the wheels to the left and the right, inspecting the harness checking for clearance or contact between the inner side of the wheel or tire assemblies. Thoroughly inspect both sides. If the wheel speed sensor harness is damaged, replace the sensor. If the harness needs adjustment, raise the vehicle on a hoist and remove the wheel. Carefully spread the clamp of the lower wire harness-mounting bracket. Reposition the harness until the excess slack is removed. Be careful not to pull the wire harness too tight. Using pliers, re-crimp the lower bracket clamp. Reinstall the wheel, lower the vehicle to the ground, and confirm the harness to wheel clearance.