



BRAKES

ENGINEERED SOLUTIONS

Bulletin BES 07-20

Subject: DSC lamp illuminated

Vehicle Involved: BMW E70 with Dynamic Stability Control through Jan 2007

Condition: The DSC (Dynamic Stability Control) warning lamp is on with all or some of the following fault codes stored: 6E58, 6E04, 5EBA, and D36F

Repair Procedure: Wiring harness to the DSC acceleration sensor is tensioned too tightly and may cause the wire to cut or create a poor connection over a period of time.

The DSC sensor is located in the front passenger foot well.

Inspect the wire and repair the wire and / or connection. To prevent a recurrence, relieve the tension in the harness by cutting back the tape at the branch connection.