



***BRAKES***

# ENGINEERED SOLUTIONS

**No. BES 09-11**  
Revised

**Subject:** Noisy brake pedal

**Vehicle Involved:** 2004 – 08 GM Cars and Light trucks. Buick Rainiers, Enclaves, Chevy, Colorado, Trailblazers, Malibus, GMC Canyons, Envoy, Acadias, and Pontiac G6s.

**Condition:** Squeaking noise from under hood when brake pedal is slowly depressed or released with engine on or off. The noise may be isolated to the Master cylinder area.

**Repair Procedure:**

While having an assistant press on the brake pedal, listen under the hood. If you are able to determine the master cylinder is the cause of the noise, remove as much fluid as possible and refill the master cylinder with new DOT 3 fluid (GM Part number 888628060, In Canada use P/N 88862807).

Start the engine and fully cycle the brake pedal to allow the new fluid to enter the system, until the noise diminishes.