



**BRAKES**

# ENGINEERED SOLUTIONS

**Bulletin BES 13-08**

**Subject:** ABS and Stability control light illuminated

**Vehicles Involved:** 2008-12 Chevy Express/GMC Savana

**Condition:** DTC C0045 and/or C0050 stored in EBCM

**Repair Procedure:** The most likely cause for this condition is the front wheel speed sensor harness being misrouted around the front brake hose. This issue may cause the harness to become too taut as it is routed through the suspension. As a result of this condition the wiring at the wheel speed sensor harness may pull out from the connector as the suspension moves up and down. The wheel speed sensor may require replacement. Be sure to route the harness parallel to the brake hose.

